

Category 15, Accessory

050/79
1/17/79
(Cont'd)

5. Extend pole subassembly. all the way out. Wind excess cable to drive mechanism.

6. Replace cover, brackets, and attached wiring.

II. Warranty Application (Pole Subassembly R & R)

Warranty Period 12 Months/12,000 Miles

DEFECT CODE	TOTAL LABOR HOURS	PART NUMBER "MAIN CAUSE"		COLOR CODE	LABOR OPERATION	LABOR HOURS
00	0.8	8869 66 9410			15 - 2 - 08	0.4
		NOTICE			AT	0.4
					TOTAL	0.8

Category 15, Accessory

1979 GLC AIR CONDITIONER

051/79
1/17/79

Due to the plastic blower housing on GLC's produced after September 1978, the ground for the air conditioner blower and idle cut relay must be relocated to a blower mounting bolt for proper operation.

